### Firmware Version 17.07.01 Summary

Purpose of Release: Recommended update to all i4250, i4650 and i4850 scanners

Date: August 4, 2017

#### **Recommended Host Driver Version:**

i4x50 Driver Installation Disk Version: 01.07.01

#### **Embeeded Firmware subsystem versions**

Name	Versions
IPC:	170701
SMC:	170701
PRC:	170701
FONTS:	000100
FPGAH:	1D0000
DSP:	060100
SM:	000500
LPCCA:	161101
LPCCB:	010000
AUDIO:	000200
IDP:	001200
UDDS:	160602
ELEV:	020300

#### New Features from Firmware 17.01.03:

- 1. DIAS-1089 Add Photo segmentation in i4x50.
- 2. DIAS-910 Add an alteration for changing how iThresholding works for high contrast Black and White documents

#### Improvements from FW 17.01.03:

- 1. DIAS-1000 Auto Brightness for Color images has been changed so that colors are more consistent.
  - An orange strip is still orange and not red most of the time
- 2. DIAS-1203 USB communication error happens with Smart Touch and pressing the play button on an attached flatbed to start the scan function.
- 3.

### Firmware Version 17.01.03 Summary

Purpose of Release: Recommended update to all i4250, i4650 and i4850 scanners

Date: March 2, 2017

#### **Recommended Host Driver Version:**

i4x50 Driver Installation Disk Version: 01.07.00

#### New Features from Firmware 16.08.01:

- 4. CR 5398 Background Color Smoothing Change to White added with both FW and Host Software are updated.
- 5. CR 5448 /DIAS-848 Add Metal Staple Detection into all newly built i4x50 scanners and a service upgrade kit for previously purchased i4x50 scanners

#### Improvements from FW 16.08.01:

- DIAS-562 Dark green document and Auto Orientation is not working all the time
  A custom alteration is available to address.
- DIAS-548 Dark green document will always be removed when "remove by document content is set"
  A custom alteration is available to address.
- 8. DIAS-539 Automatic Orientation with Default 90,180,270 was not working correctly with FW160801
- 9. DIAS-530 Fixed an internal scanner firmware memory leak when Hole Fill is enabled.

Notes:

### Firmware Version 16.08.01 and Host CD 01.04.00 Summary

Purpose of Release: Recommended update to all i4250, i4650 and i4850 scanners

Date: August 24, 2016

#### **Recommended Host Driver Version:**

i4x50 Driver Installation Disk Version: 01.04.00 Required for SmartTouch functionality

#### New Features from Firmware 16.08.01:

#### Note: New format for Firmware version number.

- 16 = Year
- 08 = Month

#### 01 = Release number of that month

- 10.CR 5082-Add Smart Touch support
- 11.CR 5004, 5094-Add "Orange" and "Orange and Red" color dropout
- 12. CR 4999-Add a new OCP screen in the setup screen list that would allow the interactive multifeed ignore during scanning feature to be configured to either automatically disable after being active for one sheet
- 13.CR 4861-Change OCP error code from "Check Front Imaging Guide and Illumination" to "Check Front Imaging Guide"
- 14. CR 5362 Add a fragile feed mode alteration to support 200 DPI output images at 600 DPI transport speed
- 15.CR 5379 Add Arabic language auto orientation
- 16.CR 5052 Add ability to disable OCP overrides via an alteration
- 17.CR 5377 Add alteration to allow for the changing Multifeed trail edge keep out zone
- 18.CR 4861 Change OCP error code from "Check Front Imaging Guide and Illumination" to "Check Front Imaging Guide" 19.CR 5397 Add Arabic OCP Translations

#### Improvements from FW 16.007.02.:

- 20. PR 25694 Print counter reacted improperly with jams and the jam action set to pause
- 21. PR 25676 Home sensor missing from service component screen
- 22. PR 25562 Scanner does not "beep" when there is a Multifeed and Multifeed = continue is the selection
- 23. PR 25696 Jams at S0 and not S1 cause the print counter to skip a number
- 24. PR 25386 Imaging LEDS may stay on when pod is opened during Jam recovery
- 25. PR 25351 If PC powered up after scanner may not, USB connection may not occur
- 26. PR 25198 RED OCP LED not always coming on when a jam occurs
- 27. PR 26095 Improvements to auto cropping when colored tabs are present on the documents
- 28. PR 26082, 26135, 24845 Hole Fill improvements
- 29. PR 26444 blank page removal by content improvements
- 30. PR 26826- When a Multifeed is detected on a color toggle patch when using Interactive Multifeed causes system hang

#### Notes:

- Color Toggle Patch and Dual Stream on an i4850 at 300 DPI may not run at 150 PPM. The choice of the image processing that is enabled can effect this PPM. Turning off Edge Fill or Bar Code Image Enhancement is recommended based on the customer needs. Turning off Hole Fill may also result in advantageous system performance.

### Firmware Version 1.16.0 Summary

**Purpose of Release:** Recommended update to all i4250, i4650 and i4850 scanners to correct an issue that may causes the scanner to intermittently not power on correctly.

Date: January 8th, 2016

**Recommended Host Driver Version:** i4x50 Driver Installation Disk Version: 1.2

New Features from FW 1.14.0: 31.N/A

#### Improvements from FW 1.14.0:

32. Corrects problem which causes the scanner to intermittently not power on correctly. Error 0002 or Error 1118.

#### Notes:

- This is only an update to the Firmware, no updates to the TWAIN driver or ISIS driver were done.

### **Firmware Version 1.14.0 Summary**

**Date:** September 10<sup>th</sup>, 2015

#### **Recommended Host Driver Version:**

i4x50 Driver Installation Disk Version: 1.1

#### New Features from FW 1.6.0:

1. N/A

#### **Improvements from FW 1.6.0:**

- **1.** Barcode enhancement
- 2. Ability to scan 360" long document

#### Firmware Version 1.6.0 Summary (Release Notes Updated 2015-07-02)

**Purpose of Release:** This release was the initial shipping release firmware for the Kodak i4250, i4650 and i4850 scanners.

**Date:** June 16<sup>th</sup>, 2015

**Recommended Host Driver Version:** 

i4x50 Driver Installation Disk Version: 1.1

#### New Features from FW 1.0.0:

1. N/A

#### **Improvements from FW 1.0.0:**

1. N/A

#### **Supported Models:**

Kodak i4250, Kodak i4650, Kodak i4850

#### Notes:

- All pre-production Kodak i4250, i4650 and i4850 scanners should be updated to this firmware version or greater.
- The Barcode Image Enhancement feature is not enabled in this release. This feature will be enabled in an upcoming release.
- Kodak Driver based barcode reading improvements for PDF417 barcodes are planned for an upcoming release.